



INSPECTION REPORT

PRE-SHIPMENT INSPECTION · HOME APPLIANCE

Report No. IQC-20260902-BLANKET · Inspection date: September 2, 2026 · Sample report — client and supplier identities withheld

General Information

Client Name	Confidential
Factory Name	Withheld for this sample
Factory Address	Withheld for this sample
Product Name	Electric Blanket
Item Number	GL-BL14
P.O. Number	—
Order Quantity	1012PCS
Actual Finished Quantity	1012PCS
Inspection Type	PSI
Inspector(s)	Artiste
Sample Available	Yes
Inspection Started at	2026-09-02
Inspection Completed at	2026-09-02

Brief Report **NOT CONFORM**

1. 100% finished and packed;
2. No shipping mark & packing method & label and measure data from client for the inspection, Please refer to actual findings.
3. Total sampled 80pcs for checking workmanship, found 5pcs minor defects. The total defects rate is 6.25%.
4. All defects were been rework and replaced on site.
5. No confirmed samples were provided for reference, please refer to the actual pictures.
6. Product bag: no warning labels, with air holes.
7. No Pantone color card available at factory
8. Power cord model: ML-T330, mismatch with product model GL-BL14

9. 9.Color box: with indentations and streaks, indentations: 100%, streaks: 100%

A. Bulk Summary

Nr.	Item Number	Completed quantity	Semi-Finished Quantity/Pcs	Actual Finished Quantity/Pcs		
Nr.	Item Number	Packed/Pcs	Unpacked/Pcs	Total packed Carton/Ctns	Semi-Finished Quantity/Pcs	Actual Finished Quantity/Pcs
1	GL-BL14	1012	0	253	0	1012
Total	1012	0	253	0	1012	
Remarks	100% finished and packed					

B. Packing Information

Nr.	Item Number	Packing Details	Carton Size	Carton Weight	Inner Packing Size	Inner Packing Weight
1	GL-BL14	4color box/cartons	61×43.5×37.3cm	10.89kg	40×35×14.5cm	2.43kg

C. Workmanship

ANSI/ASQZ1.4-2008, Single Sampling Plan:							
Quality Standard		Acceptance Quality Limit (AQL):	Sample Size				
Quality Standard		Critical	Major	Minor	Sample Size		
AQL level II		AQL 0	AQL 2.5	AQL 4.0	80pcs		
Nr.	Item Number	Sample Size	Defect Description	Critical	Major	Minor	Defects Rate
1	GL-BL14	80	Loose threads	0	3	3.76%	
2	GL-BL14	80	Stains	0	2	2.5%	
Total Defects Found:		0	5	6.25%			
Max Allowed:		0	5	7	/		

D. Defects Disposal

Nr.	Item Number	Defect Description	Data records			
Nr.	Item Number	Defect Description	Defect Quantity	Handled on Site	Promise to Handle	Not Handled
1	GL-BL14	Loose threads	3	0		
2	GL-BL14	Stains	2	0		

E. Product Details

Product Measurement Data					
No.	Item Number	Type	Sample Nr.	Size	Net Weight
1	GL-BL14	Main	Required	180×130cm	2kg
1	GL-BL14	Main	Sample 1	180.5X130.4cm	2kg
1	GL-BL14	Main	Sample 2	180.3X130cm	2kg
1	GL-BL14	Main	Sample 3	180X130.5cm	2kg
1	GL-BL14	Accessory	Power cord	214cm	-

F. Data Measurement / Field Test


Nr.	Product Name	Field Test	Test Requirement	Quantity	Conclusion
1	Electric Blanket	Aging test	-	32	Pass
2	Electric Blanket	Color comparison	-	20	Pass
3	Electric Blanket	Leakage current test	-	20	Pass
4	Electric Blanket	Odor test	-	20	Pass
5	Electric Blanket	Carton Drop test	-	20	Pass
6	Electric Blanket	Color fastness test	-	20	Pass
7	Electric Blanket	Barcode scanning test	-	20	Pass
8	Electric Blanket	Product temperature test	-	20	Pass
9	Electric Blanket	Power measurement	-	20	Pass
10	Electric Blanket	Controller function test	-	20	Pass
11	Electric Blanket	3M tape test	-	20	Pass

Appendix: Inspection Photos

Loose threads-Minor	Stains-Minor
Stains-Minor	N/A
Controller function test	Odor test
Finished Goods	
N/A	



Appendix: Inspection Photos

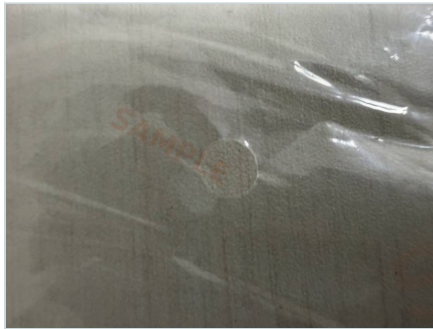

Appendix: Inspection Photos




Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos

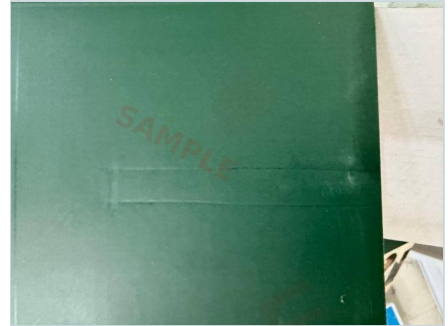

Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos




Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos

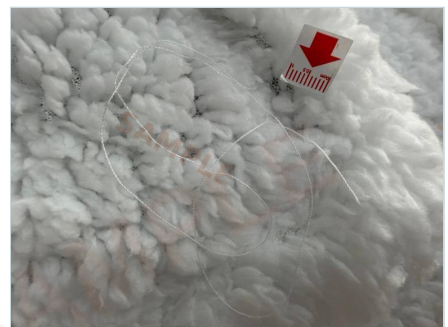

Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos




Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos

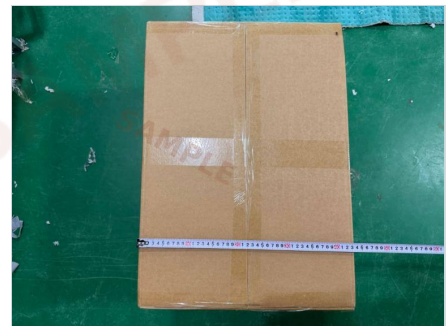

Appendix: Inspection Photos



Appendix: Inspection Photos




Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos

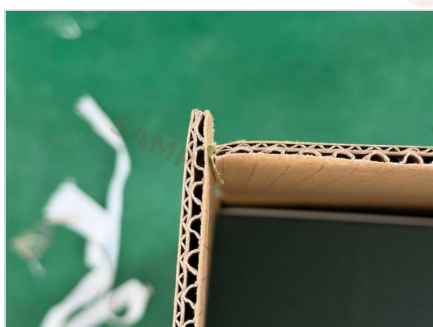

Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos




Appendix: Inspection Photos




Appendix: Inspection Photos




Appendix: Inspection Photos

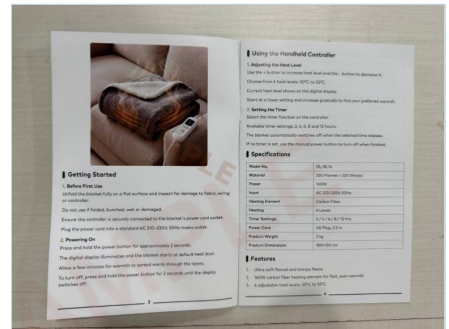

Appendix: Inspection Photos

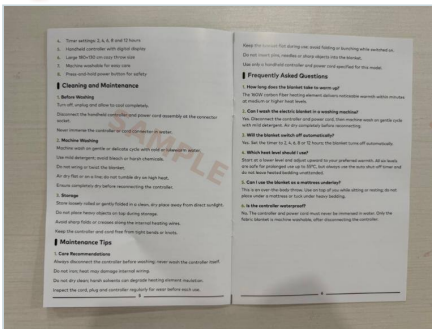

Appendix: Inspection Photos

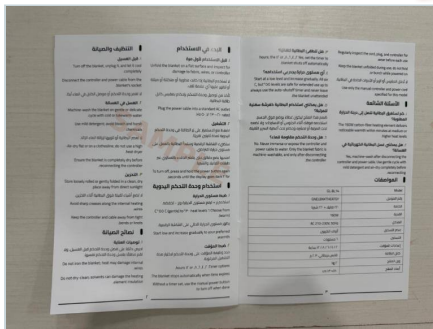

Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos




Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos

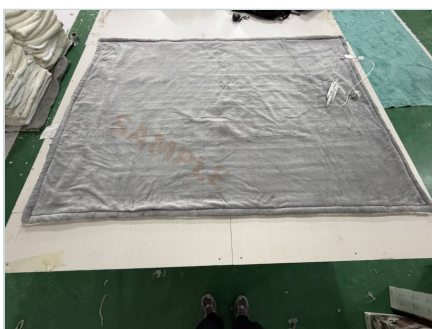

Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos




Appendix: Inspection Photos




Appendix: Inspection Photos



Appendix: Inspection Photos

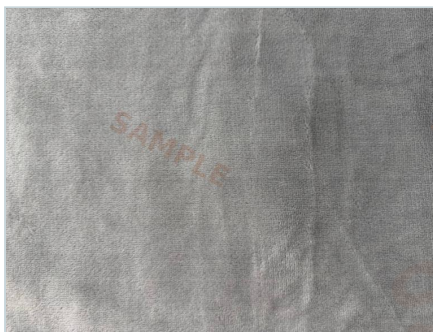

Appendix: Inspection Photos

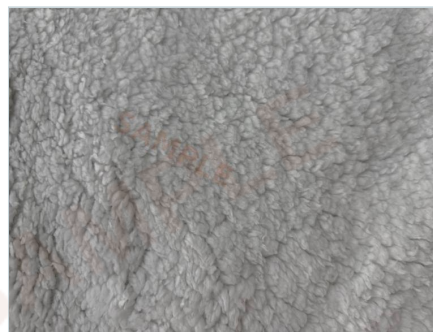

Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos




Appendix: Inspection Photos




Appendix: Inspection Photos



Appendix: Inspection Photos

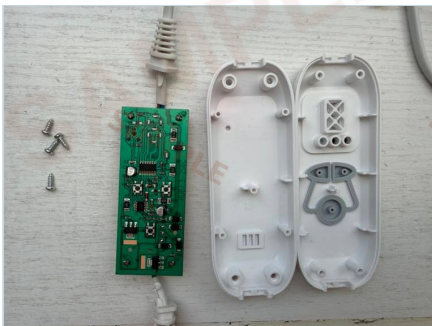

Appendix: Inspection Photos

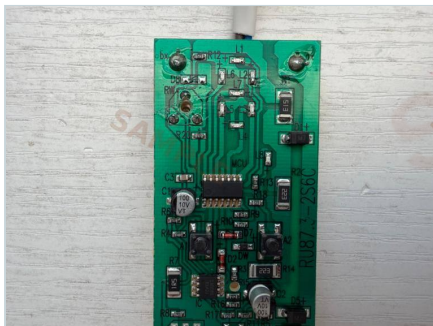

Appendix: Inspection Photos

Photo archive abridged in this sample (80 photos shown). Every Import QC report is delivered with the complete photo archive.

END OF REPORT

This is a genuine inspection performed by the Import QC inspector network, published as a sample with client and supplier identities withheld. The results reflect our findings at the time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right to compensation for any apparent and/or hidden defects not detected during random inspection or occurring thereafter. © Import QC · www.importqc.com