

Inspection Report

GENERAL INFORMATION

Client Name	Withheld for this sample		 
Factory Name	Withheld for this sample		
Factory Address	Wenzhou City, Zhejiang Province		
Product Name	Drawstring Bag		
Item Number	HPDB05/TWTD01		
P.O. Number	-		
Order Quantity	6000pcs		
Actual Finished Quantity	6000pcs		
Inspection Type	☐ IPC ☐ DUPRO ☒ PSI ☐ Re-Inspection ☐ Full Inspection		
Inspector(s)	Carey Teng	Sample Available	☐ Yes ☒ No
Inspection Started at	2026-05-11	Inspection Completed at	2026-05-11

BRIEF REPORT

Overall Conclusion	Pending						
Inspection Standard	ANSI/ASQ Z1.4 Single Sampling Plan: AQL Level II			Defects	Critical	Major	Minor
				AQL	0	2.5	4.0
				Sample size	200pcs		
				Max	0	10	14
				Found	0	2	6
Brief Findings	A. Bulk Summary (Link to details)	Conform	Not Conform	Pending	Remark 1		
	B. Packing Information (Link to details)	Conform	Not Conform	Pending	Remark 2		
	C. Workmanship (Link to details)	Conform	Not Conform	Pending	Remark 3		
	D. Defects Disposal (Link to details)	Conform	Not Conform	Pending	Remark 4		
	E. Product Details (Link to details)	Conform	Not Conform	Pending	Remark 5		
	F. Field Test (Link to details)	Conform	Not Conform	Pending	Remark 6		
Remarks	1. All bulk goods have been fully produced. 5,000 pieces in 40 cartons have been packed, accounting for 83.33%. The remaining 1,000 pieces are being packed at the factory. 2. Only pasted shipping marks label on two cartons. The factory stated that all carton marks will be uniformly attached before shipment. 3. Total sampled 200pcs for checking workmanship, found 2 major and 6 minor defects. The total defects rate is 4%.						

Inspection Report

4. All defective products were not reworked or replaced on site.
5. No approved sample is available for inspection reference.
6. The factory did not provide Pantone color card for color inspection and comparison.

A. BULK SUMMARY

[Back To Summary](#)

Nr.	Item Number	Completed quantity			Semi-Finished Quantity/Pcs	Actual Finished Quantity/Pcs
		Packed/Pcs	Unpacked/Pcs	Total packed Carton/Ctns		
1	HPDB05	3000	0	20	0	3000
2	TWTD01	2000	1000	30	0	3000
Total		5000	1000	50	0	6000

B. PACKING INFORMATION

[Back To Summary](#)

Nr.	Item Number	Packing Details	Carton Size/cm	Carton Weight/kg
1	HPDB05	Each product is packed into one poly bag, and 150 poly bags are packed into one carton.	49.5x40.5x38	17.35
2	TWTD01	Each product is packed into one poly bag, and 100 poly bags are packed into one carton.	48x39x38	11.1

C. WORKMANSHIP

[Back To Summary](#)

ANSI/ASQZ1.4-2008, Single Sampling Plan:				
Quality Standard	Acceptance Quality Limit (AQL):			Sample Size
	Critical	Major	Minor	
AQL level II	AQL 0	AQL 2.5	AQL 4.0	200pcs

Nr.	Item Number	Sample Size	Defect Description	Critical	Major	Minor	Defects Rate
1	HPDB05	100	Foreign fibres	0	2	0	2%
2			Untrimmed thread ends	0	0	2	2%
3	TWTD01	100	Untrimmed thread ends	0	0	2	2%
4			Foreign fibres	0	0	1	1%
5			Dirty mark	0	0	1	1%
Total Defects Found:				0	2	6	4%
Max Allowed:				0	10	14	/

Inspection Report

Defects- HPDB05	
	
Foreign fibres-Major	Foreign fibres-Major
	
Untrimmed thread ends-Minor	Untrimmed thread ends-Minor

Defects- TWTD01	
	

Inspection Report

Untrimmed thread ends-Minor	Untrimmed thread ends-Minor
	
Foreign fibres-Minor	Dirty mark-Minor

D. DEFECTS DISPOSAL

[Back To Summary](#)

Nr.	Item Number	Defect Description	Data records			
			Defect Quantity	Handled on Site	Promise to Handle	Not Handled
1	HPDB05	Foreign fibres	2	2	0	0
2		Untrimmed thread ends	2	2	0	0
3	TWTD01	Untrimmed thread ends	2	2	0	0
4		Foreign fibres	1	1	0	0
5		Dirty mark	1	1	0	0

Inspection Report

E. PRODUCT DETAILS						Back To Summary
Product Measurement Data						
Item	Item Number	Type	Sample Nr.	Size/cm	Net Weight/g	
1	HPDB05	Main	Required	35x42	/	
			Sample 1	35x41.5	102.6	
			Sample 2	35x41.5	102.4	
			Sample 3	35x42	102.5	
2	TWTD01	Main	Required	44x37.5	-	
			Sample 1	43.5x38	94.2	
			Sample 2	43.5x37.5	94.5	
			Sample 3	44x38	94.4	
		Insulated bag	Required	34x19.5	/	
			Sample 1	34x19.5	/	
			Sample 2	34x19.5	/	
			Sample 3	34x19.5	/	

F. DATA MEASUREMENT / FIELD TEST						Back To Summary
Nr.	Product Name	Field Test	Test Requirement	Quantity	Conclusion	
1	Drawstring Bag	Rubbing test	Test surface printing/coating abrasion resistance	5pcs/item	Pass	
2		3M tape test	Test surface printing/coating adhesion with 3M tape.	5pcs/item	Pass	
3		Loading Test	Test product loading bearing performance.	5pcs/item	Pass	
4		Tensile Test	Test tensile strength of the product.	5pcs/item	Pass	
5		Function test	Perform functional test, check if the product can perform without any failure as described.	5pcs/item	Pass	
6		Smell test	No irritating odors allowed	200pcs	Pass	
7		Stitch density inspection	Check stitching density of the product.	5pcs/item	Pass	
8		Color Check	Check product color and shade; no color deviation or uneven tone allowed.	5pcs/item	Pass	

APPENDIX: INSPECTION PHOTOS


Packing & Product details & Size- HPDB05



Export carton view



Export carton view

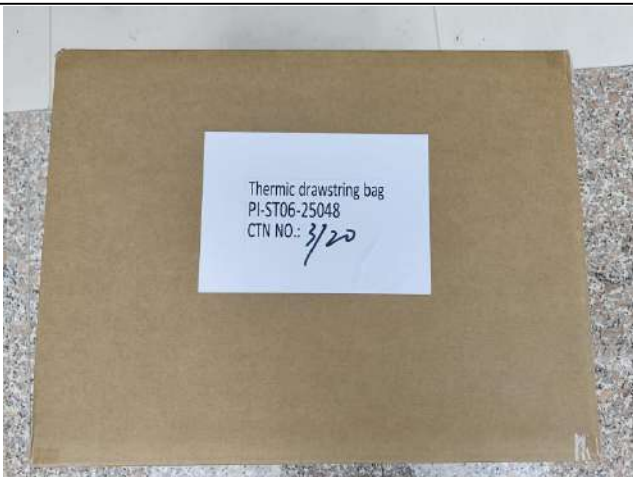



Shipping mark view



Side mark view



Inspection Report

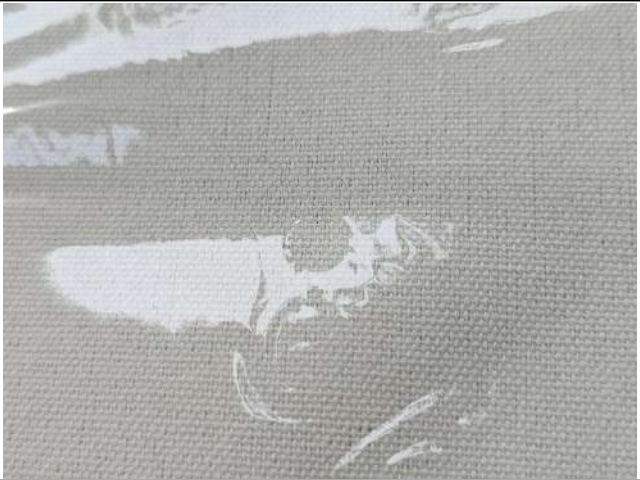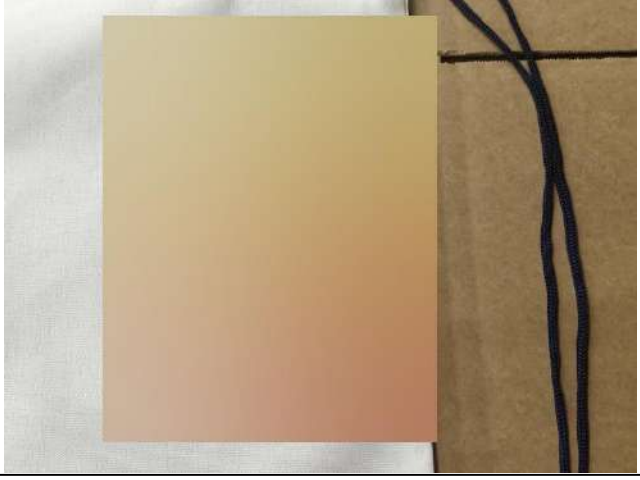Open carton view	5-ply
	
Packaging view	Air hole
	
Product view	Product view
	
Product view	Product view
	

Inspection Report

	
Product view	Product view
	
Product view	Product view
	
Product view	Product view

Packing & Product details & Size- HPDB05



Carton weight check



Carton weight check




Carton size check



Carton size check



Carton size check

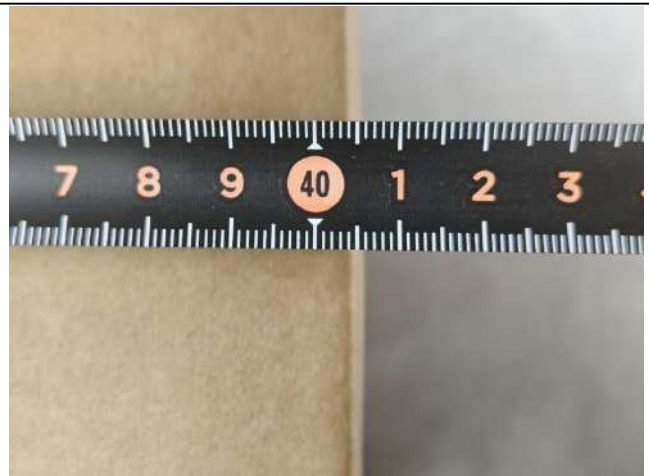

Carton size check

Inspection Report

	
Carton size check	Carton size check
	
Packaging size check	Packaging size check
	
Packaging size check	Packaging size check

Inspection Report

	
Packaging weight check	Product weight check
	
Product size check	Product size check
	
Product size check	Product size check

Inspection Report

Packing & Product details & Size- TWTD01



Export carton view



Export carton view



Shipping mark view



Side mark view



Open carton view



5-ply

Inspection Report

	
Packaging view	Air hole
	
Product view	Product view
	
Product view	Product view

Inspection Report

	
Product view	Product view
	
Product view	Product view
	
Product view	Product view

Inspection Report



Product view



Product view



Product view



Product view



Product view



Product view

Inspection Report

Packing & Product details & Size- TWTD01



Carton weight check



Carton weight check



Carton size check



Carton size check



Carton size check



Carton size check

Inspection Report

	
Carton size check	Carton size check
	
Packaging weight check	Packaging size check
	
Packaging size check	Packaging size check

Inspection Report



Packaging size check



Product weight check




Product size check



Product size check



Product size check

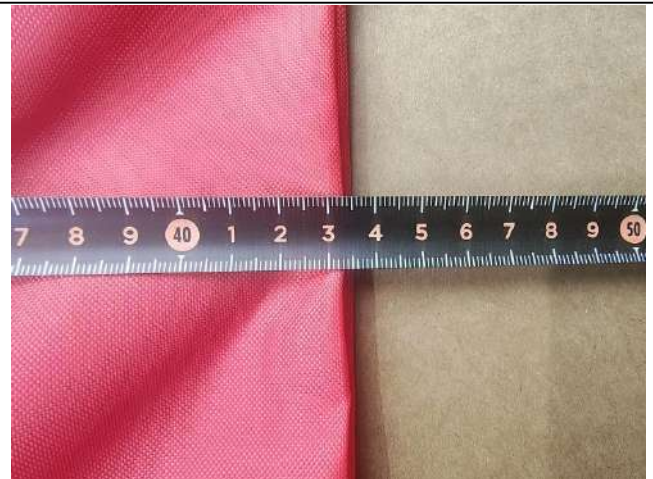

Product size check


Inspection Report

	
Product size check	Product size check
	
Product size check	Product size check


Field tests photos



Rubbing test

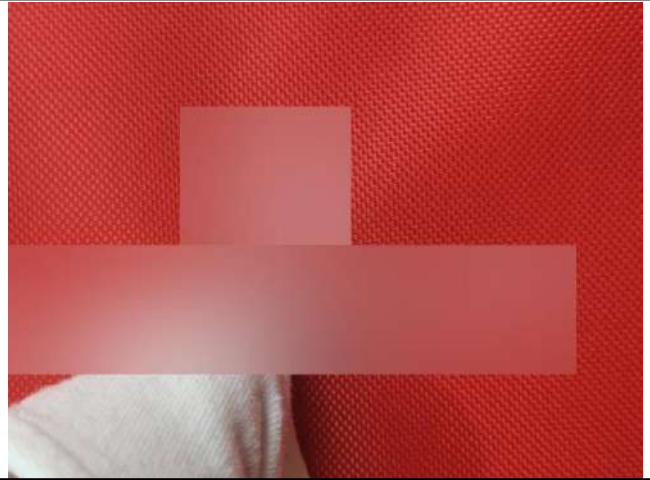


Rubbing test

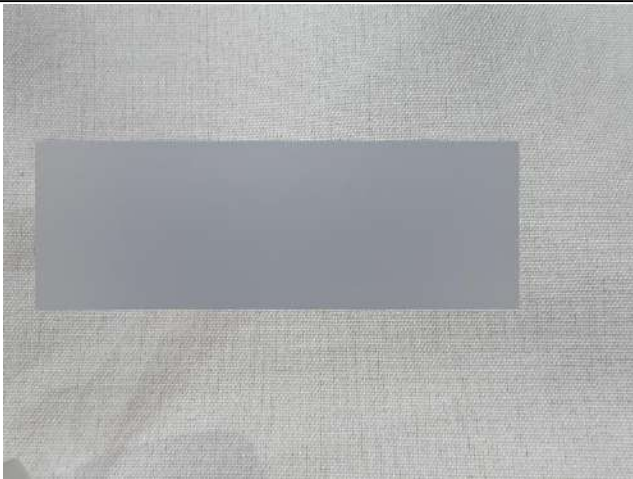

3M tape test



3M tape test

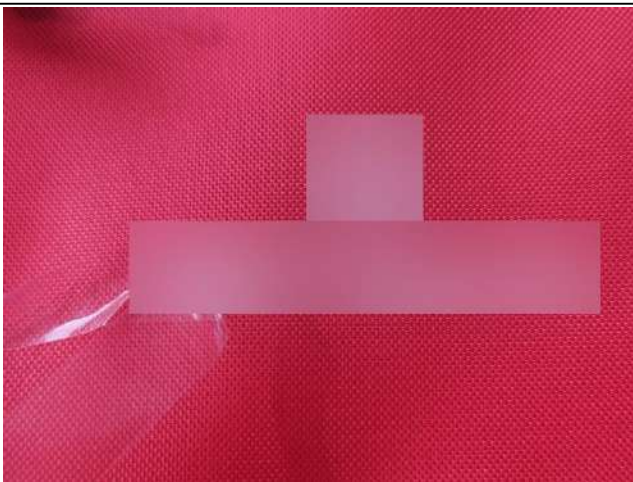

3M tape test



Loading Test

Inspection Report



Loading Test



Loading Test



Loading Test



Loading Test



Loading Test




Smell test

Inspection Report

	
Smell test	Tensile Test
	
Tensile Test	Tensile Test
	
Tensile Test	Tensile Test

Inspection Report

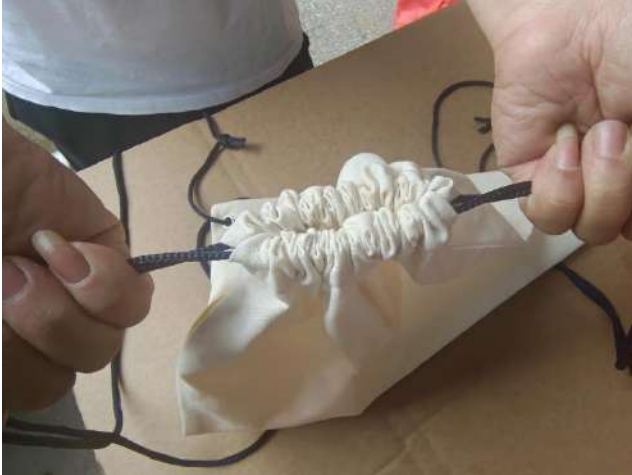	
Tensile Test	Tensile Test
	
Tensile Test	Tensile Test
	
Function test	Function test

Inspection Report



Function test



Function test



Stitch density inspection




Stitch density inspection



Inspection Report



Color Check

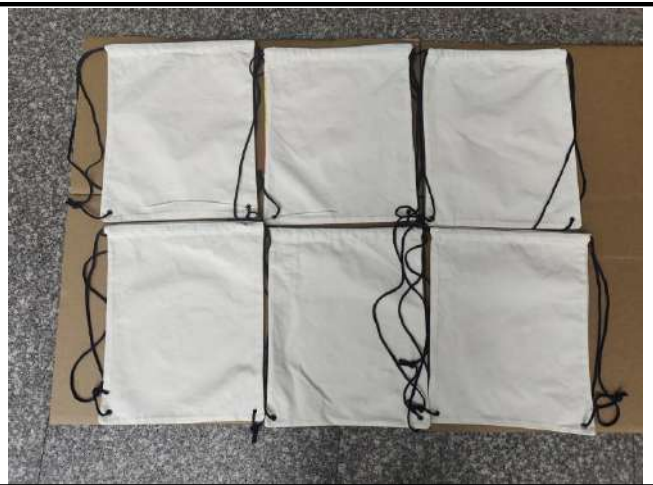

Color Check

APPENDIX:OTHER PHOTOS

Others



Finished Goods



Finished Goods




Unpacked



Sampled Cartons

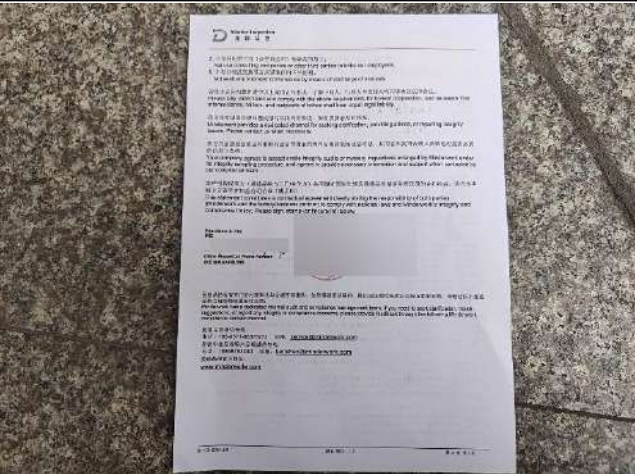

Sampled Products 	Sampled Products 
Anti-Bribery 	Anti-Bribery 

----- END OF THIS REPORT -----