

Inspection Report

GENERAL INFORMATION

Client Name	Withheld for this sample			
Factory Name	Withheld for this sample			
Factory Address	Fujian Province,China			
Product Name	Foot massager			
Item Number	LV-36			
P.O. Number	SW78-0812			
Order Quantity	700pcs			
Actual Finished Quantity	702pcs			
Inspection Type	☐ IPC ☐ DUPRO ☒ PSI ☐ Re-Inspection ☐ Full Inspection			
Inspector(s)		Sample Available	☐ Yes ☒ No	
Inspection Started at	2026-09-10	Inspection Completed at	2026-09-10	

BRIEF REPORT

Overall Conclusion	Pending						
Inspection Standard	ANSI/ASQ Z1.4 Single Sampling Plan: AQL Level II			Defects	Critical	Major	Minor
				AQL	0	2.5	4.0
				Sample size	80pcs		
				Max	0	5	7
				Found	0	1	4
Brief Findings	A. Bulk Summary (Link to details)	Conform	Not Conform	Pending	Remark 1		
	B. Packing Information (Link to details)	Conform	Not Conform	Pending	Remark 2,5		
	C. Workmanship (Link to details)	Conform	Not Conform	Pending	Remark 3		
	D. Defects Disposal (Link to details)	Conform	Not Conform	Pending	/		
	E. Product Details (Link to details)	Conform	Not Conform	Pending	Remark 4,8		
	F. Field Test (Link to details)	Conform	Not Conform	Pending	Remark 6,7		
Remarks	1. Actual finished 702pcs and packed. 2. No shipping mark, label information and packing information were provided for reference, please refer to the actual pictures. 3. Total sampled 80pcs for checking workmanship, found 1 major and 4 minor defects. All defects were been rework or raplaced on site. 4. No product specification was provided for reference, detail please refer to pictures. 5. No found warning words on polybag, only air hole on it. 6. Factory did not provide equipment to conduct high voltage/power/working current and						

Inspection Report

	DB test. 7. The products can use at both 220V and 110V, no found failer. 8. No confirmed samples were provided for reference,, please refer to the actual pictures.
--	---

A. BULK SUMMARY [Back To Summary](#)

No.	Item	Completed quantity			Semi-Finished Quantity/Pcs	Actual Finished Quantity/Pcs
		Packed/Pcs	Unpacked/Pcs	Total packed Carton/Ctns		
1	LV-36	702	0	71	0	702
Total		702	0	71	0	702
Remarks			100% finished and packed			

B. PACKING INFORMATION [Back To Summary](#)

No.	Item	Packing Details	Carton Size	Carton Weight	Inner Packing Size	Inner Packing Weight
1	LV-36	1pc/inner box, 10pcs per outer carton	76x35x40.7cm	12.7kg	33x14.8x19cm	1.15kg

C. WORKMANSHIP [Back To Summary](#)

ANSI/ASQZ1.4-2008, Single Sampling Plan:						
Quality Standard	Acceptance Quality Limit (AQL):			Sample Size		
	Critical	Major	Minor			
AQL level II	AQL 0	AQL 2.5	AQL 4.0	80pcs		

No.	Item	Sample Size	Defect Description	Critical	Major	Minor	Defects Rate
1	LV-36	80pcs	Pin hole	0	1	0	1.25%
2			Sewing wrinkly	0	0	1	1.25%
3			Untrimmed thread end	0	0	3	3.75%
Total Defects Found:				0	1	4	6.25%
Max Allowed:				0	5	7	/

Defects-LV-36	
	
Pin hole-Major	Sewing wrinkly-Minor
	
Untrimmed thread end-Minor	Untrimmed thread end-Minor

	Nil
Untrimmed thread end-Minor	Nil

D. DEFECTS DISPOSAL			Back To Summary			
No.	Item	Defect Description	Data records			
			Defect Quantity	Handled on Site	Promise to Handle	Not Handled
1	LV-36	Pin hole	1	1	0	0
2		Sewing wrinkly	1	1	0	0
3		Untrimmed thread end	3	3	0	0

E. PRODUCT DETAILS				Back To Summary	
Product Measurement Data					
No.	Item	Type	Sample Nr.	Size	Net Weight
1	LV-36	Main	Required	N/A	N/A
			Sample 1	31.8x17x13.8cm	1.0kg
			Sample 2	31.9x17x13.9cm	1.0kg
			Sample 3	32x17x14cm	1.0kg
		Accessory	DC wire	93cm	/

F. DATA MEASUREMENT / FIELD TEST				Back To Summary		
No.	Product	Field Test	Test Requirement	Quantity	Conclusion	
1	LV-36	Carton drop test	Drop test on 3 cartons 10 times (1 corner/3 edges/6 sides). After dropping, no functional damage, cracking or	1	Pass	

Inspection Report

			deformation occurs on the products. Packaging and goods are intact and meet shipping safety requirements.		
2		Barcode scan test	Barcodes can be scanned and read correct.	5	Pass
3		Smell test	No abnormal odor (chemical, plastic, or pungent smell)	80	Pass
4		Function test	Perform functional test, check if the product can perform without any failure as described.	5	Pass
5		Power on check	after testing the samples should pass the hi voltage check, function check, earth continuity check etc., and no defect found.	5	Pass
6		Voltage check	12V	5	Pass
7		Internal check	Check internal construction completment	1	Pass
8		3M test	Use 3M Tape on the screen printing of product to see if it can fall off. The peeled-off area shall not exceed 10%.No fading, smudging, or ink transfer is allowed.	5	Pass

APPENDIX: INSPECTION PHOTOS



Inspection Report



Inspection Report













Inspection Report











Nil

Field Tests Photos



Carton Drop test



Carton Drop test



Carton Drop test



Carton Drop test



Inner box Drop test	Inner box Drop test
	
Inner box Drop test	Inner box Drop test
	
After drop test-use ok	Barcode scanning



Function check-220V



Function check-220V




Function check-220V



Function check-220V




Inspection Report

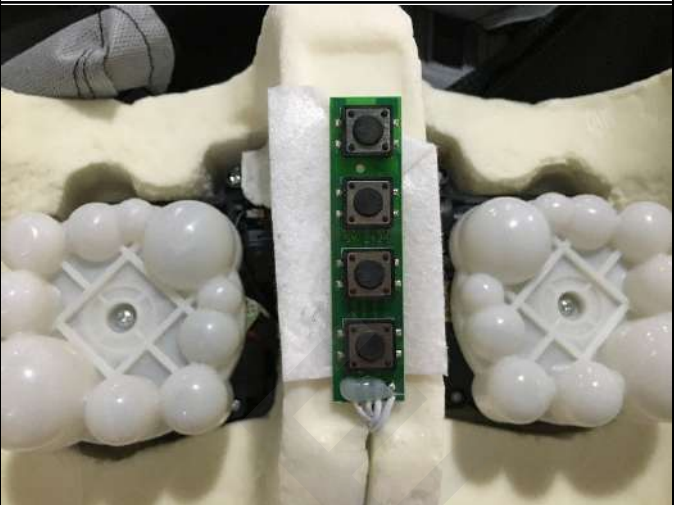
Function check-110V	Function check-110V
	
Internal check	Internal check
	
Internal check	Internal check




Internal check

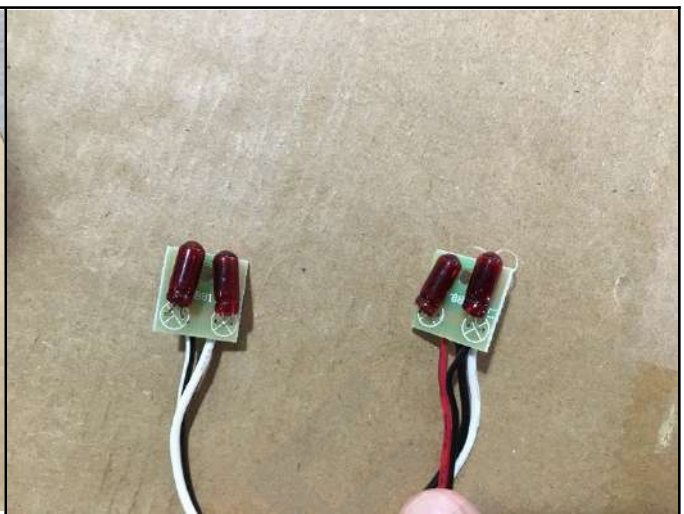


Internal check

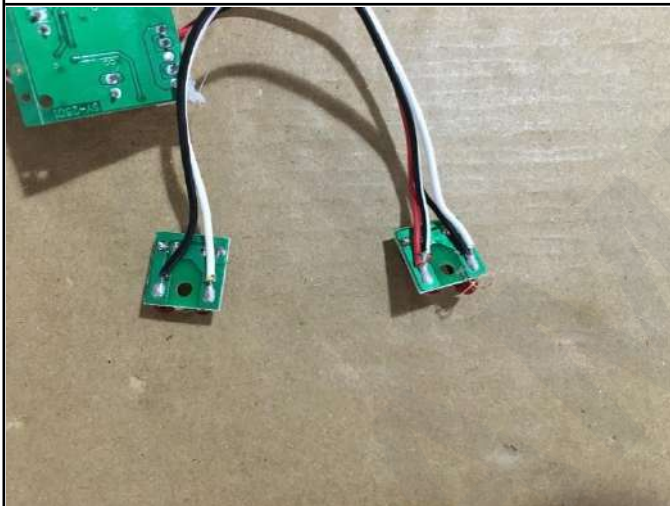

Internal check

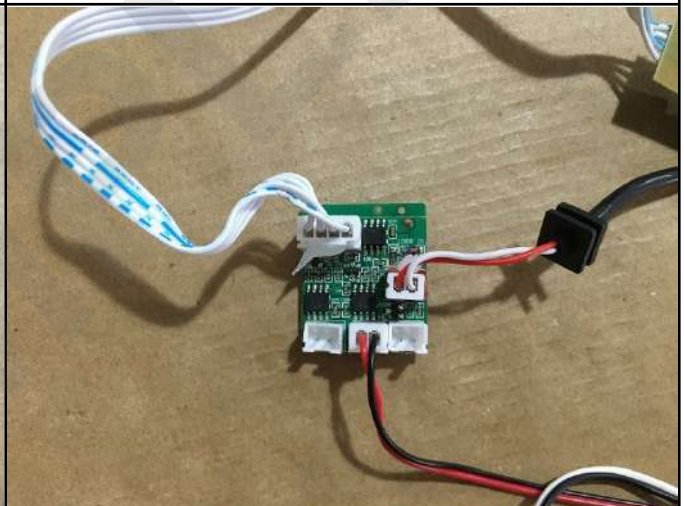

Internal check

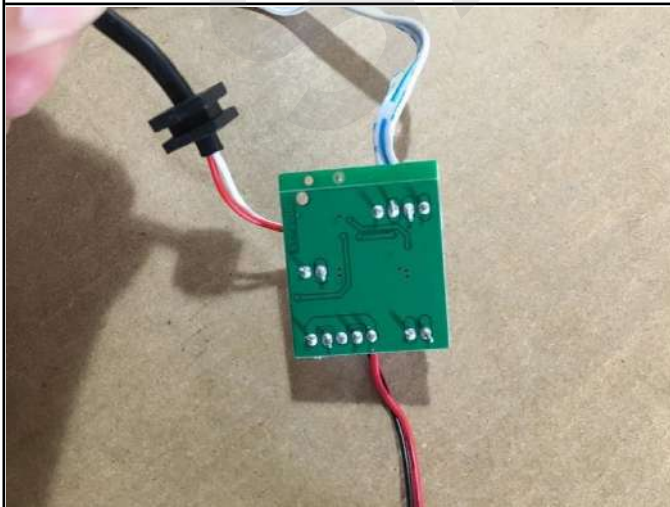

Inspection Report

Internal check 	Internal check 
Power on check--220V-2H 	Smell check 
Auto off time check	Auto off time check



Auto off time check



3M tape test



Rubbing test



Rubbing test



Output voltage	Output voltage
	
Pull test	Use check

APPENDIX:OTHER PHOTOS

Others	
	
Factory gate	Finished Goods

Inspection Report



Finished Goods



Partial carton packing



Sampled Cartons



Sampled Products

----- END OF THIS REPORT -----