



INSPECTION REPORT

PRE-SHIPMENT INSPECTION · FOOTWEAR

Report No. IQC-20260621-SLIPPERS · Inspection date: June 21, 2026 · Sample report — client and supplier identities withheld

General Information

Client Name	Confidential
Factory Name	Withheld for this sample
Factory Address	Withheld for this sample
Product Name	Ladies slippers
Item Number	RDSA-13001/RDSA-13002 RDSA-13005/RDSA-13006
P.O. Number	—
Order Quantity	6048Pairs
Actual Finished Quantity	6048Pairs
Inspection Type	PSI
Inspector(s)	Mike Huang
Sample Available	Yes
Inspection Started at	2026-06-21
Inspection Completed at	2026-06-21

Brief Report PENDING

1. 100% finished and packed.
2. No shipping mark and packing information were provided for reference, please refer to the actual pictures.
3. Total sampled 200pcs, found 1 major and 11 minor defects.
4. For item#RDSA-13005/RDSA-13006, found 2pcs hole in the upper, factory explanation is that it is caused by the production process and is unavoidable.
5. Factory has provided supplier's sample for reference.
6. For item#RDSA-13005/RDSA-13006, actual product color are slight lighter than supplier's sample.
7. RDSA-13001&RDSA-13002: Found each pair of slippers has a different color, and even the left and right shoes of the same pair of slippers are not exactly the same.

A. Bulk Summary

Nr.	Item Number	Completed quantity	Semi-Finished Quantity/Pcs	Actual Finished Quantity/Pcs		
Nr.	Item Number	Packed/Pcs	Unpacked/Pcs	Total packed Carton/Ctns	Semi-Finished Quantity/Pcs	Actual Finished Quantity/Pcs
1	RDSA-13001	1512	0	126	0	1512
2	RDSA-13002	1512	0	126	0	1512
3	RDSA-13005	1512	0	126	0	1512
4	RDSA-13006	1512	0	126	0	1512
Total	6048	0	504	0	6048	
Remarks	100% finished and packed					

B. Packing Information

Nr.	Item Number	Packing Details	Carton Size	Carton Weight	Inner Packing Size	Inner Packing Weight
1	RDSA-13001	1pair/polybag, 12pairs into one carton.	42.5×23.5×29.3cm	2.5kg	/	
2	RDSA-13002	1pair/polybag, 12pairs into one carton.	42.5×23.5×29.2cm	2.5kg	/	
3	RDSA-13005	1pair/polybag, 12pairs into one carton.	42.5×23.5×29cm	3.3kg	/	
4	RDSA-13006	1pair/polybag, 12pairs into one carton.	42.5×23.5×29.1cm	2.85kg	/	

C. Workmanship

ANSI/ASQZ1.4-2008, Single Sampling Plan:							
Quality Standard		Acceptance Quality Limit (AQL):	Sample Size				
Quality Standard		Critical	Major	Minor	Sample Size		
AQL level II		AQL 0	AQL 2.5	AQL 4.0	200pcs		
Nr.	Item Number	Sample Size	Defect Description	Critical	Major	Minor	Defects Rate
1	RDSA-13001	50	Dirty mark	0	1	2.0%	
2	RDSA-13001	50	Offcut not clean	0	1	2.0%	

3	RDSA-13001	50	Press marking	0	1	2.0%	
4	RDSA-13002	50	Color stain	0	2	4.0%	
5	RDSA-13002	50	Dirty mark	0	1	2.0%	
6	RDSA-13005	50	Air hole on side	0	1	0	2.0%
7	RDSA-13005	50	Offcut not clean	0	2	4.0%	
8	RDSA-13006	50	Dirty mark	0	1	2.0%	
9	RDSA-13006	50	Edge chipped	0	1	2.0%	
10	RDSA-13006	50	Flash not clean	0	1	2.0%	
Total Defects Found:		0	1	11	6.0%		
Max Allowed:		0	10	14	/		

D. Defects Disposal

Nr.	Item Number	Defect Description	Data records			
Nr.	Item Number	Defect Description	Defect Quantity	Handled on Site	Promise to Handle	Not Handled
1	RDSA-13001	Dirty mark	1	0		
2	RDSA-13001	Offcut not clean	1	0		
3	RDSA-13001	Press marking	1	0		
4	RDSA-13002	Color stain	2	0		
5	RDSA-13002	Dirty mark	1	0		
6	RDSA-13005	Air hole on side	1	0		
7	RDSA-13005	Offcut not clean	2	0		
8	RDSA-13006	Dirty mark	1	0		
9	RDSA-13006	Edge chipped	1	0		
10	RDSA-13006	Flash not clean	1	0		

E. Product Details

Product Measurement Data						
Item	Item Number	Size#	Required size	Actual Size (cm)	Required weight	Actual weight (g)
1	RDSA-13001	6	24	24.1×10	N/A	146
1	RDSA-13001	6.5	24.7	24.7×10	N/A	149
1	RDSA-13001	7	25.3	25.3×10	N/A	153
1	RDSA-13001	7.5	26	26×10.2	N/A	156

1	RDSA-13001	8	26.7	26.7×10.7	N/A	170
1	RDSA-13001	8.5	27.3	27.3×11	N/A	175
2	RDSA-13002	6	24	24.1×10	N/A	140
2	RDSA-13002	6.5	24.7	24.6×10	N/A	144
2	RDSA-13002	7	25.3	25.4×10	N/A	151
2	RDSA-13002	7.5	26	26×10.3	N/A	157

2	RDSA-13002	8	26.7	26.8×10.7	N/A	171
2	RDSA-13002	8.5	27.3	27.4×11	N/A	174
3	RDSA-13005	6	24	24×9.3	N/A	206
3	RDSA-13005	6.5	24.7	24.7×9.5	N/A	208
3	RDSA-13005	7	25.3	25.3×9.5	N/A	221
3	RDSA-13005	7.5	26	26×9.7	N/A	229
3	RDSA-13005	8	26.7	26.7×10	N/A	243
3	RDSA-13005	8.5	27.3	27.4×10	N/A	252
4	RDSA-13006	6	24	24×9.3	N/A	158
4	RDSA-13006	6.5	24.7	24.7×9.5	N/A	174
4	RDSA-13006	7	25.3	25.4×9.5	N/A	187
4	RDSA-13006	7.5	26	26×9.7	N/A	198

4	RDSA-13006	8	26.7	26.7×10	N/A	206
4	RDSA-13006	8.5	27.3	27.4×10	N/A	210

F. Data Measurement / Field Test

Nr.	Product Name	Field Test	Quantity	Conclusion
1	All items	Carton drop test	1	Pass
2	All items	Smell test	200pcs	Pass
3	All items	3M test	5pcs/item	Pass
4	All items	Rubbing test	5pcs/item	Pass
5	All items	Pull test	5pcs/item	Pass
6	All items	Flex test	5pcs/item	Pass
7	All items	Hardness test	5pcs/item	Actual finding
8	All items	Fitting test	5pcs/item	Pass

Appendix: Inspection Photos

Dirty mark-minor	Offcut not clean-minor
Press marking-minor	Nil
Dirty mark-minor-minor	Nil
Air hole on side-major	Offcut not clean-minor
Offcut not clean-minor	Nil
Dirty mark-minor-minor	Edge chipped -minor
Flash not clean-minor	Nil
Carton Drop test	Label removed check
Hardness check	Hardness checkfl
Finished Goods	
Inspected cartons	Inspected samples



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos




Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos

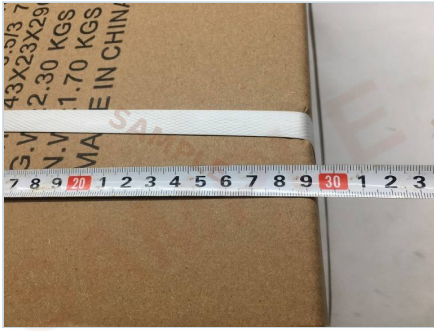

Appendix: Inspection Photos



Appendix: Inspection Photos




Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos

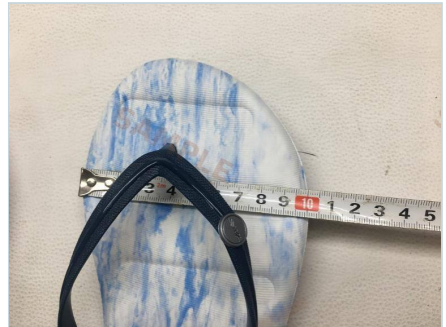

Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos

Photo archive abridged in this sample (80 photos shown). Every Import QC report is delivered with the complete photo archive.

END OF REPORT

This is a genuine inspection performed by the Import QC inspector network, published as a sample with client and supplier identities withheld. The results reflect our findings at the time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right to compensation for any apparent and/or hidden defects not detected during random inspection or occurring thereafter. © Import QC · www.importqc.com