



INSPECTION REPORT

PRE-SHIPMENT INSPECTION · FOOTWEAR

Report No. IQC-20260618-SHOES · Inspection date: June 18, 2026 · Sample report — client and supplier identities withheld

General Information

Client Name	Confidential
Factory Name	Withheld for this sample
Factory Address	Withheld for this sample
Product Name	Shoes
Item Number	RHZA-92012,RHZA-92013,RHZA-92014,RHZA-92015,RDZA-14027,RDZA-14028,RDZA-14030,RDZA-14031,RDZA-14033,RDZA-14034
P.O. Number	—
Order Quantity	8244Pairs
Actual Finished Quantity	8244Pairs
Inspection Type	PSI
Inspector(s)	Tony Zheng
Sample Available	Yes
Inspection Started at	2026-06-18
Inspection Completed at	2026-06-18

Brief Report PENDING

1. 100% finished and 97.7%packed.
2. No packing information were provided for reference, please refer to the actual pictures.
3. Total sampled 200pcs for checking workmanship, found 7 major and 12 minor defects.
4. All the defects have been shown to the factory and advised the factory to replace these samples.
5. No PP sample or confirmed samples were provided for inspection reference, please refer to section 'E'.
6. No failure was found during the actual field tests.

A. Bulk Summary

Nr.	Item Number	Completed quantity	Semi-Finished Quantity/Pcs	Actual Finished Quantity/Pcs		
Nr.	Item Number	Packed/Pcs	Unpacked/Pcs	Total packed Carton/Ctns	Semi-Finished Quantity/Pcs	Actual Finished Quantity/Pcs
1	RHZA-92012	840	0	70	0	840
2	RHZA-92013	840	0	70	0	840
3	RHZA-92014	1308	0	109	0	1308
4	RHZA-92015	1008	0	84	0	1008
5	RDZA-14027	600	0	50	108	708
6	RDZA-14028	672	0	56	36	708
7	RDZA-14030	660	0	55	48	708
8	RDZA-14031	708	0	59	0	708
9	RDZA-14033	708	0	59	0	708
10	RDZA-14034	708	0	59	0	708

Total	8052	0	671	192	8244
Remarks	100% finished and 97.7%packed				

B. Packing Information

Nr.	Item Number	Packing Details	Carton Size(cm)	Carton Weight(kg)
1	RHZA-92012	1 pair with 1copy paper into 1 inner box, 12pairs/carton, carton with 4sides shipping marks	76.7×54.8×37.2	12.55
2	RHZA-92013	1 pair with 1copy paper into 1 inner box, 12pairs/carton, carton with 4sides shipping marks	76.7×54.8×37.2	12.45
3	RHZA-92014	1 pair with 1copy paper into 1 inner box, 12pairs/carton, carton with 4sides shipping marks	76.7×54.8×37.2	12.50
4	RHZA-92015	1 pair with 1copy paper into 1 inner box, 12pairs/carton, carton with 4sides shipping marks	76.7×54.8×37.2	12.45
5	RDZA-14027	1 pair with 1copy paper into 1 inner box, 12pairs/carton, carton with 4sides shipping marks	73.8×52.5×33.5	10.65

6	RDZA-14028	1 pair with 1copy paper into 1 inner box, 12pairs/carton, carton with 4sides shipping marks	73.8×52.5×33.5	10.60
7	RDZA-14030	1 pair with 1copy paper into 1 inner box, 12pairs/carton, carton with 4sides shipping marks	73.8×52.5×33.5	10.25
8	RDZA-14031	1 pair with 1copy paper into 1 inner box, 12pairs/carton, carton with 4sides shipping marks	68.0×52.7×33.3	10.55
9	RDZA-14033	1 pair with 1copy paper into 1 inner box, 12pairs/carton, carton with 4sides shipping marks	68.0×52.7×33.3	10.45
10	RDZA-14034	1 pair with 1copy paper into 1 inner box, 12pairs/carton, carton with 4sides shipping marks	68.0×52.7×33.3	10.35

C. Workmanship

ANSI/ASQZ1.4-2008, Single Sampling Plan:							
Quality Standard	Acceptance Quality Limit (AQL):	Sample Size					
Quality Standard	Critical	Major	Minor	Sample Size			
AQL level II	AQL 0	AQL 2.5	AQL 4.0	200pcs			
Nr.	Item Number	Sample Size	Defect Description	Critical	Major	Minor	Defects Rate
1	RHZA-92012	20	Scratch mark	0	1	0	5.00%
1	RHZA-92012	20	Untrimmed thread ends	0	1	5.00%	
2	RHZA-92013	21	Obviously stain mark	0	1	0	4.76%
2	RHZA-92013	21	Glue mark	0	2	9.52%	
3	RHZA-92014	32	Stain mark	0	1	0	3.13%
3	RHZA-92014	32	Glue mark on bottom	0	1	3.13%	
3	RHZA-92014	32	High cement line	0	1	3.13%	
4	RHZA-92015	25	Glue mark	0	1	4.00%	
5	RDZA-14027	17	Crease mark	0	1	0	5.88%
5	RDZA-14027	17	Glue mark	0	1	5.88%	
6	RDZA-14028	17	Dirty mark	0	1	5.88%	
7	RDZA-14030	17	Poor cementing	0	1	0	5.88%
7	RDZA-14030	17	Untrimmed thread ends	0	1	5.88%	
8	RDZA-14031	17	Crease mark	0	1	0	5.88%
8	RDZA-14031	17	Glue mark	0	1	5.88%	

9	RDZA-14033	17	Scratch mark	0	1	0	5.88%
9	RDZA-14033	17	Glue mark	0	1	5.88%	
10	RDZA-14034	17	Glue mark	0	1	5.88%	
Total Defects Found:		0	7	12	9.50%		

Max Allowed:	0	10	14	/
--------------	---	----	----	---

D. Defects Disposal

Nr.	Item Number	Defect Description	Data records			
Nr.	Item Number	Defect Description	Defect Quantity	Handled on Site	Promise to Handle	Not Handled
1	RHZA-92012	Scratch mark	1	0	1	0
1	RHZA-92012	Untrimmed thread ends	1	0		
2	RHZA-92013	Obviously stain mark	1	0	1	0
2	RHZA-92013	Glue mark	2	0		
3	RHZA-92014	Stain mark	1	0	1	0
3	RHZA-92014	Glue mark on bottom	1	0		
3	RHZA-92014	High cement line	1	0		
4	RHZA-92015	Glue mark	1	0		
5	RDZA-14027	Crease mark	1	0	1	0
5	RDZA-14027	Glue mark	1	0		

6	RDZA-14028	Dirty mark	1	0		
7	RDZA-14030	Poor cementing	1	0	1	0
7	RDZA-14030	Untrimmed thread ends	1	0		
8	RDZA-14031	Crease mark	1	0	1	0
8	RDZA-14031	Glue mark	1	0		
9	RDZA-14033	Scratch mark	1	0	1	0
9	RDZA-14033	Glue mark	1	0		
10	RDZA-14034	Glue mark	1	0		

E. Product Details

Size(mm)	5	6	6.5	7	7.5	8	8.5	9	9.5	10
RHZA-92012	/	261	267	274	282	287	293	301		
RHZA-92013	/	260	267	273	281	288	293	301		
RHZA-92014	/	261	268	273	280	287	294	301		

RHZA-92015	/	260	267	274	281	287	293	300	
RDZA-14027	233	240	247	254	260	267	/	273	/
RDZA-14028	233	240	248	254	261	267	/	273	/
RDZA-14030	234	241	247	255	260	268	/	273	/
RDZA-14031	234	240	247	254	260	267	/	273	/
RDZA-14033	232	241	248	255	261	268	/	272	/
RDZA-14034	234	240	247	254	260	267	/	273	/

F. Data Measurement / Field Test

Nr.	Product Name	Field Test	Quantity	Conclusion
1	All items	Carton drop test	10	Pass
2	All items	Model test	10	Pass
3	All items	Strain relief test	10	Pass
4	All items	3M paste test	10	Pass
5	All items	Fastness test	10	Pass
6	All items	Color shades	10	Pass
7	All items	Bending test	10	Pass
8	All items	Fitting test	10	Pass

Appendix: Inspection Photos

1 Scratch mark-Major	2 Untrimmed thread ends-Minor
1 Obviously stain mark-Major	2 Glue mark-Minor
1 Stain mark-Major	2 Glue mark on bottom-Minor
1 Crease mark-Major	2 Glue mark-Minor
1 Poor cementing-Major	2 Untrimmed thread ends-Minor
1 Crease mark-Major	2 Glue mark-Minor
1 Scratch mark-Major	2 Glue mark-Minor
1 Carton drop test	2 Carton drop test
3 Model test	4 Model test
5 Model test	6 Model test
7 Model test	8 Model test
9 Model test	10 Model test
11 Model test	12 Model test

13 Model test	14 Model test
15 Strain relief test	16 Strain relief test
17 Strain relief test	18 Strain relief test
19 3M paste test	20 3M paste test
21 3M paste test	22 3M paste test
23 Fastness test	24 Fastness test
25 Fastness test	26 Fastness test
27 Fastness test	28 Fastness test
29 Color shades	30 Color shades
31 Color shades	32 Color shades
33 Color shades	34 Color shades

35 Color shades	36 Color shades
37 Bending test	38 Bending test
39 Bending test	40 Bending test
41 Fitting test	42 Fitting test
Warehouse	/



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos




Appendix: Inspection Photos




Appendix: Inspection Photos



Appendix: Inspection Photos

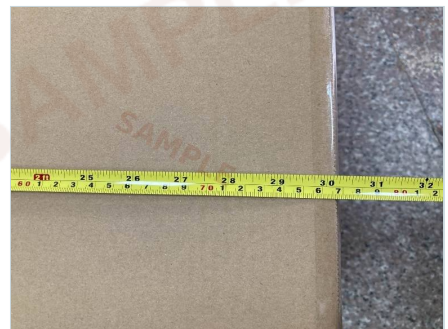

Appendix: Inspection Photos

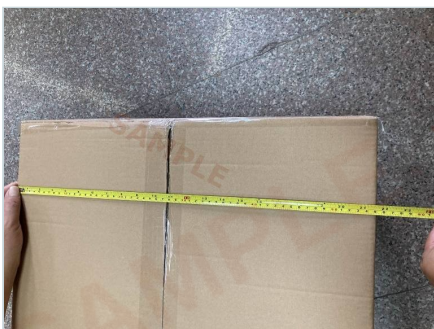

Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos




Appendix: Inspection Photos




Appendix: Inspection Photos



Appendix: Inspection Photos

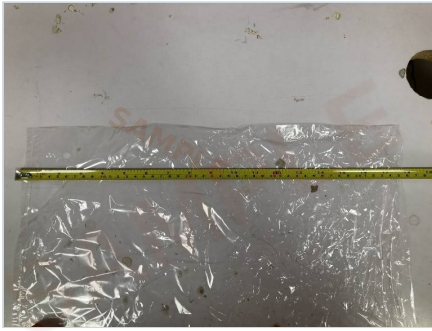

Appendix: Inspection Photos

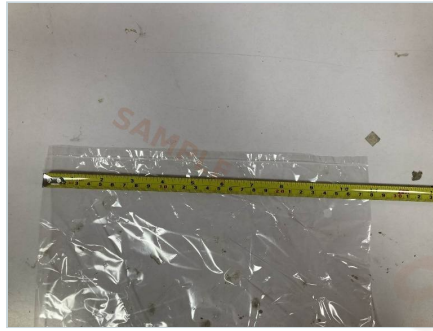

Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos




Appendix: Inspection Photos




Appendix: Inspection Photos



Appendix: Inspection Photos

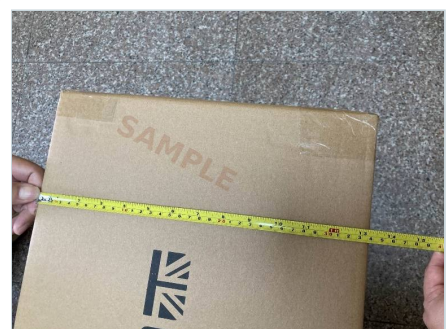

Appendix: Inspection Photos

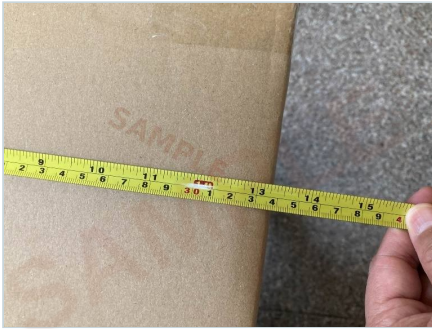

Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos




Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos

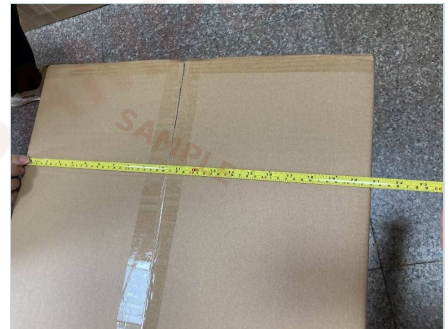

Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos



Appendix: Inspection Photos

Photo archive abridged in this sample (80 photos shown). Every Import QC report is delivered with the complete photo archive.

END OF REPORT

This is a genuine inspection performed by the Import QC inspector network, published as a sample with client and supplier identities withheld. The results reflect our findings at the time and place of inspection. This report does not relieve sellers/manufacturers from their contractual liabilities or prejudice buyers' right to compensation for any apparent and/or hidden defects not detected during random inspection or occurring thereafter. © Import QC · www.importqc.com